

Field Remedy: 1435

Subject: **Door locks - Seized**

Models:

VX220 2000...2002,Speedster 2000...2002

Engines:

Z22SE,Z22SE

Option:

Complaint: Lock cylinder is seized or key is difficult to turn

Cause: Lock barrel grease dried-out

Production:

Remedy:

In case of customer complaint do not remove door lock from door. Insert Lock Cylinder Grease part no. 9163311, catalog no. 19 48 610 directly into the lock barrel through the key entry. Rotate key after initial application of grease until smooth operation is achieved.

Note: Previous use of lock de-icer will cause the original lubricant to dry out and the use of Lock Cylinder Grease is recommended to maintain smooth operation. It is also advised to apply this grease to door locks during the Annual Service.

The grease is currently available to order on the above part numbers and these will be published in the May 2002 issue of the EPC.

FunctionalGroup: C - Equipment/Windows/Seats

Complaint Group: 13 - No/Poor Function

Trouble Code: No