

Field Remedy: 1653

Subject: F23 transmission - Bad cold shifting behaviour in 1st and 2nd gear

Models:

Astra-G 1998...2004,Zafira
1999...2004,Speedster 2001...2004,VX220
2001...2004,Vectra-B 1998...2004,Vectra-C
2002...2004,Signum 2003...2004

Engines:

All,All,All,All,All,All,All

Option:

F23
Transmission

Complaint:

Some customer complain about bad cold shifting behaviour in 1st and 2nd gear. The gearshift mechanism is correctly adjusted and clutch system is bled.

Cause:

Tolerances of tothing of the sliding gear.

Production:

Introduction of transmission with modified siding gear as of transmission number Gxx03240969 in calendar week 41 / 2003.

Remedy:

In case of customer complaint the sliding gear has to be replaced by using the Repair Kit, Partno.: 9201451 / Catalogno.: 16 07 013. There is no need to replace the entire transmission.

FunctionalGroup:

K - Clutch/Transmission

Complaint Group:

08 - Hard to operate

Trouble Code:

None