

Field Remedy: 1467

Subject: **Rear Lamps - Water ingress**

Models: **Engines:** **Option:**

Speedster 2000...2002 Z22SE

Complaint: Water ingress on rear lamps.

Cause: Poor position of sealing rear light.


Production:

Remedy:


In case of customer complaint cut and remove a foam rubber section of rear lamps.

Working Procedure:

1. Remove rear lamps
 - see working procedure "Rear Lamp, Remove and Install", group "N", Service Instruction Speedster.
2. Cut and remove foam rubber section "x" of rear lamps with suitable tool (picture I, X=20 mm).

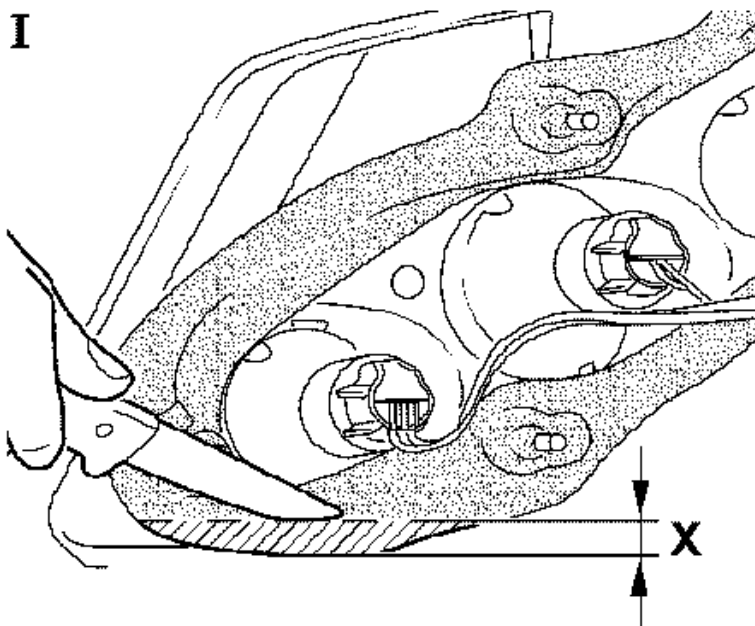

3. Is the seal solved by cutting, fix the seal with gluing compound seal (picture II).

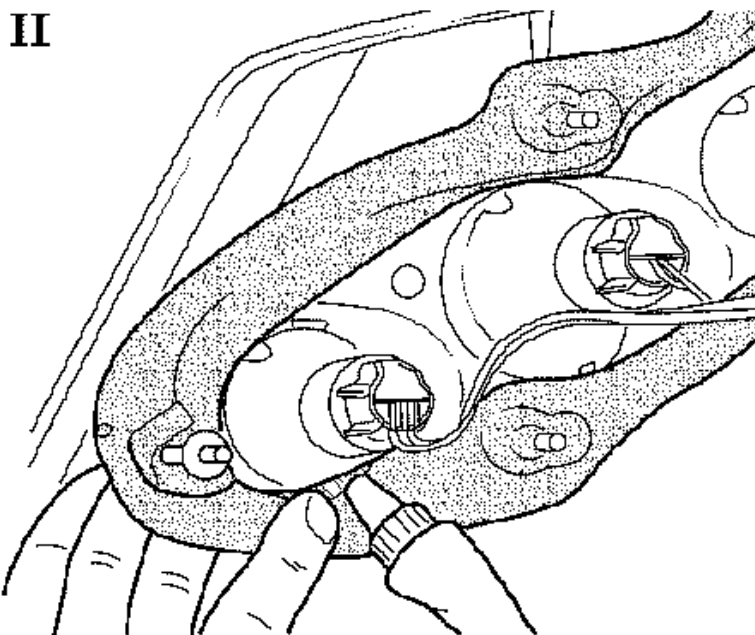

4. Install rear lamps

- see working procedure "Rear Lamp, Remove and Install", group "N", Service Instruction Speedster.

Labour Times:	TC:	Hours:
T 8 146 70 Foam rubber cut rear lamp	92	0.5
Spare-Parts:	Part-No.:	Catalog-No.:
Gluing Compound seal	90485251	15 03 295

The costs for this repair will be covered for vehicles not older than 3 years and a mileage lower than 100.000 Km.
The regular warranty procedute should be used for claiming Set-up-time.

FunctionalGroup: A - Body,N - Electrical Equipment

Complaint Group: 10 - Leakages

Trouble Code: None